




**Hex Head Machine Bolts
Hot Dip Galvanized**

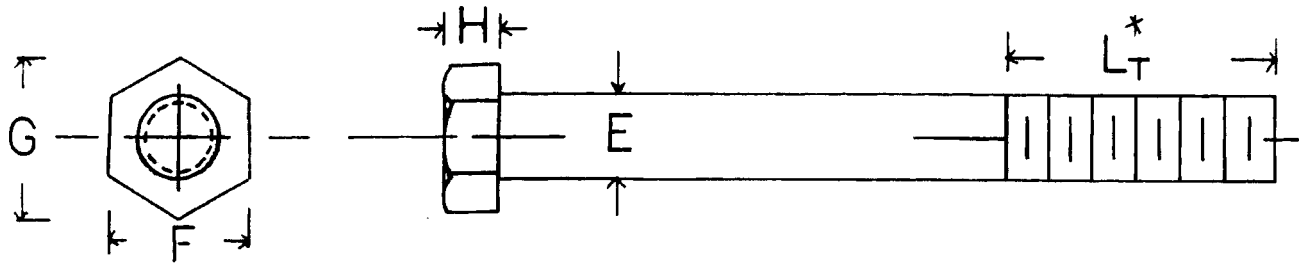


E	F	G	H	L _T *
1/2	3/4	27/32	11/32	6
5/8	15/16	1-1/16	7/16	6
3/4	1-1/8	1-1/4	1/2	6
7/8	1-5/16	1-1/2	9/16	6
1	1-1/2	1-11/16	11/16	6
1-1/8	1-11/16	1-7/8	3/4	6
1-1/4	1-7/8	2-1/8	7/8	6
1-1/2	2-1/4	2-1/2	1	6

* On bolts over 12" in length

See ASTM for dimension tolerances

**Square Head Machine Bolts
Hot Dip Galvanized**

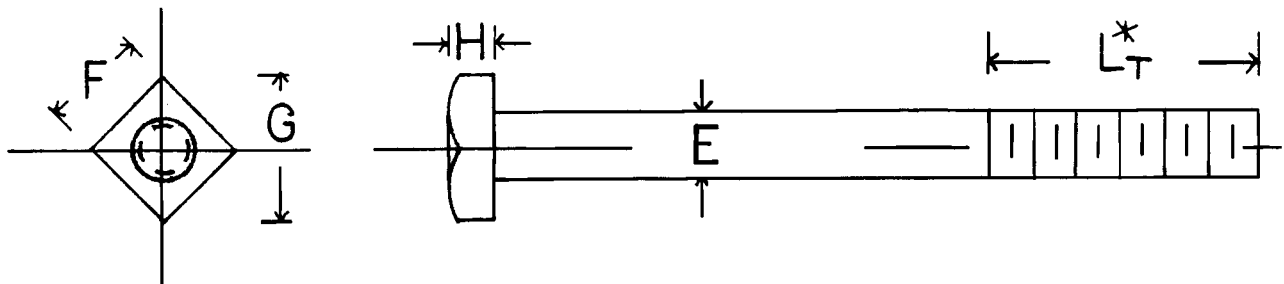

E	F	G	H	L _T *
1/2	3/4	1-1/64	11/32	6
5/8	15/16	1-5/16	7/16	6
3/4	1-1/8	1-1/2	1/2	6
7/8	1-5/16	1-3/4	19/32	6
1	1-1/2	1-1/16	21/32	6
1-1/8	1-11/16	2-5/16	3/4	6
1-1/4	1-7/8	2-9/16	7/8	6
1-1/2	2-1/4	3-1/8	1	6

* On bolts over 12" in length

See ASTM for dimension tolerances